

NO: 08-04-99

SUBJECT: Universal Garage Door Opener Range

DATE: Feb. 26, 1999

OVERVIEW:

This Bulletin Involves installing a supplemental antenna to the Electronic Vehicle Information Center (EVIC).

SYMPTOM/CONDITION:

The Universal Garage Door Opener located in the EVIC may have a reduced operating range. A supplemental antenna has been developed which will extend the effective range.

DIAGNOSIS:

If customers complain of reduced range, perform the Repair Procedure.

PARTS REQUIRED:

Qty	Part No.	Description
1	05015803AA	Antenna

REPAIR PROCEDURE:

THIS REPAIR IS COMPATIBLE WITH DAIMLERCHRYSLER'S MOBILE SERVICE PROGRAM AND DOES NOT REQUIRE HOISTS OR OTHER FULL SERVICE FACILITY SPECIAL EQUIPMENT.

1. Open the hood and disconnect the negative battery cable.
2. Remove the overhead console attaching screw.
3. Remove the overhead console by pulling it straight down. Use caution not to damage the wire harnesses.
4. Disconnect the wire harnesses and remove the console.
5. Inspect the overhead console for the presence of a copper wire antenna routed around the perimeter of the housing. If this wire is present, remove and discard it.
6. Remove the four EVIC mounting screws from the overhead console and remove the EVIC.
7. Peel the protective backing from the antenna, p/n 05015803AA, and install the antenna around the EVIC as shown in [Figure 1](#). Start at the side of the EVIC nearest the C/T Button, using the tabs on the side of the unit as a reference point.
8. Install the EVIC into the overhead console.
9. Connect the wire harnesses and install the overhead console into the roof panel.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Op. No.	Time
08-50-20-93	0.2 Hrs.

FAILURE CODE:

Code	Description
P8	New Part