NO: 18-46-98

SUBJECT: Engine Idle Undershoot/Driveway Die Out When Shifting Transmission

DATE: Dec. 18, 1998

NOTE: THIS INFORMATION APPLIES TO VEHICLES EQUIPPED WITH AN AUTOMATIC TRANSMISSION AND 4.0L ENGINE BUILT PRIOR TO DEC. 18, 1998 (MDH 1218XX).

SYMPTOM/CONDITION:

Some vehicles may exhibit an idle undershoot or driveway die out when the transmission is placed from park or neutral into drive or reverse.

DIAGNOSIS:

Using the Mopar Diagnostic System (MDS/MDS2) or the Diagnostic Scan Tool (DRB III[®]) with the appropriate Diagnostic Procedures Manual, verify all engine/transmission systems are functioning as designed. If other Diagnostic Trouble Codes (DTC's) are present, record them on the repair order and repair as necessary <u>before</u> proceeding further with this bulletin. Following the Diagnostic Procedures Manual, check the evaporative purge solenoid and circuit for proper operation. If no trouble is found, perform the Repair Procedure.

NOTE: WHENEVER A POWERTRAIN CONTROL MODULE (PCM) IS REPLACED DUE TO FAILURE, THE SOFTWARE OF THE REPLACEMENT CONTROLLER SHOULD BE VERIFIED FOR THE LATEST REVISION LEVEL. USE THE FLASH PROCEDURE TO UPDATE REPLACED CONTROLLERS AS NECESSARY.

EQUIPMENT/PARTS REQUIRED:

Qty	Part No.	Description		
1	CH6000	Scan Tool (DRB III [®])		
1	CH7035	General Purpose Interface Bus Cable (GPIB)		
1	CH7000/7001	J1962 Cable		
1	04669020	Label - Authorized Software Update		
1	04275086	Label - Authorized Modification		

NOTE: THE MDS AND DRB III[®] ARE REQUIRED TO PERFORM THIS REPAIR AND THE SYSTEM MUST BE OPERATING WITH RELEASE 21 OR HIGHER <u>AND</u> TIL CD RELEASE 1175 OR HIGHER MUST BE INSTALLED.

REPAIR PROCEDURE:

This procedure involves selectively erasing and reprogramming the Powertrain Control Module (PCM) with new software (99cal14 calibration change).

- 1. Connect the MDS (Mopar Diagnostic System) and DRB III[®] (Scan Tool) to the vehicle and power them up.
- 2. Use the arrow keys and select #2 CONNECT TO MDS 1 OR MDS 2 on the DRB III[®] MAIN MENU Screen.
- 3. Select #1 MDS DIAGNOSTICS OR DRB UPDATE on the DRB III[®].
- 4. Use the arrow keys and select DIAGNOSTIC MENU on the MDS, then press NEXT MENU.
- 5. Use the arrow keys and select VEHICLE CONTROLLER PROGRAMMING on the MDS, then press NEXT MENU.
- 6. Use the arrow keys and select PROGRAMMING OF ALL OTHER CONTROLLERS USING MDS & DRB III® on the MDS, then press NEXT MENU.
- 7. Follow the steps presented on the MDS and DRB III[®] which will allow the DRB III[®] to obtain the current part number of the PCM.
- 8. The MDS will display the part number of the PCM on the vehicle and the appropriate replacement part number, then press NEXT MENU to begin programming.

If the PCM on the vehicle has already been updated or programmed, a NO UPDATES AVAILABLE message will be displayed. Check the part number of the PCM on the vehicle and compare it to the part number displayed. If the PCM has already been updated, then another condition exists that will require further diagnosis and repair.

9. The MDS and DRB III[®] will prompt for any operator action needed during the remainder of the programming process.

NOTE: XJ VEHICLES EQUIPPED WITH AN AISIN WARNER TRANSMISSION MAY SET DTC \$BE (CCD MESSAGE FROM JTEC FAILURE) WITHIN THE TCM BECAUSE OF THE FLASH PROCEDURE AND THE DTC LOGGED IN THE TCM MAY SET DTC \$89 (TCM CONTROLLER DTC PRESENT) WITHIN THE PCM. CHECK FOR AND ERASE THESE DTC'S PRIOR TO RETURNING THE VEHICLE TO THE CUSTOMER.

NOTE: THE FOLLOWING STEPS ARE REQUIRED BY LAW.

- 10. Type the necessary information on the "Authorized Software Update Label" p/n 04669020 (Figure 1). Attach the label to the PCM and cover the label with the clear plastic overlay.
- 11. Type the necessary information on the "Authorized Modification Label" p/n 04275086 and attach the label near the VECI Label (Figure 2).

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Op. No.	Time	
08-19-42-92	0.5 Hrs.	

FAILURE CODE:

REPAIR PROCEDURE:

This procedure involves selectively erasing and reprogramming the Powertrain Control Module (PCM) with new software (99cal14 calibration change).

- 1. Connect the MDS (Mopar Diagnostic System) and DRB III® (Scan Tool) to the vehicle and powerthem up.
- 2. Use the arrow keys and select #2 CONNECT TO MDS 1 OR MDS 2 on the DRB III[®] MAIN MENUScreen.
- 3. Select #1 MDS DIAGNOSTICS OR DRB UPDATE on the DRB III[®].
- 4. Use the arrow keys and select DIAGNOSTIC MENU on the MDS, then press NEXT MENU.
- 5. Use the arrow keys and select VEHICLE CONTROLLER PROGRAMMING on the MDS, then press NEXT MENU.
- 6. Use the arrow keys and select PROGRAMMING OF ALL OTHER CONTROLLERS USING MDS & DRB III® on the MDS, then press NEXT MENU.
- 7. Follow the steps presented on the MDS and DRB III[®] which will allow the DRB III[®] to obtain the current part number of the PCM.
- 8. The MDS will display the part number of the PCM on the vehicle and the appropriate replacement part number, then press NEXT MENU to begin programming.

If the PCM on the vehicle has already been updated or programmed, a NO UPDATES AVAILABLE message will be displayed. Check the part number of the PCM on the vehicle and compare it to the part number displayed. If the PCM has already been updated, then another condition exists that will require further diagnosis and repair.

9. The MDS and DRB III[®] will prompt for any operator action needed during the remainder of the programming process.

NOTE: THE FOLLOWING STEPS ARE REQUIRED BY LAW.

- 10. Type the necessary information on the "Authorized Software Update Label" p/n 04669020 (Figure 1). Attach the label to the PCM and cover the label with the clear plastic overlay.
- 11. Type the necessary information on the "Authorized Modification Label" p/n 04275086 and attach the label near the VECI Label (Figure 2).

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Op. No.	Time	
08-19-42-92	0.5 Hrs.	

FAILURE CODE:

Code	Description

CHRYS	LER	LER
P/N:		20 TROL
DLR CODE:		NO2
DATE:		46 (T0
AUTHOR	IZED ŞQFTWARE UPDAT	e AFE

CHRYSLER	CHRYSLER AUTHORIZED MODIFICATIONS		THESE MODIFICATIONS HAVE BLEE APPRIVED AS APPRIVED BY EPA AND CARR.					
_	THE FOLLOWING MODIFICATIONS HAVE BEEN MADE:							
1	POWERTRAIN CONTROL MODULE P/N * USED							
	CHANGE AUTHORITY	DEALER	CODE	DATE				
	TSB XX-XX-XX	KKKKK		XXXXXX				
4275086								

^{*} Insert Part Number Laed